N&W GLOBAL VENDING

TECHNICAL INFORMATION

WITTENBORG

TYPE NO **ES 5100**	TYPE **Espresso machine**	T.I.-NO **ES5100 2006-01**
SERIAL NUMBERS AFFECTED	**See below**	ISSUED BY **Documentation/ Wittenborg Odense**
SUBJECT	**New dispensing valves and angle union (new supplier)**	ISSUED FOR (X): Action Information x

COMPONENTS CONCERNED

- ***Changed parts***

Article No	*Description*
41532003	Dispensing Valve 1/8" - 1.5 mm
41532005	Dispensing Valve 1/8" - 2.0 mm
062309	Angle union

- ***Omitted***

part number	*Description*
09102710	Hexagon nut M10x1

MODIFICATION

- In ES5100 machines from serial number 582529, the dispensing valve 1/8"-1.5 mm, part number 41532003, has been replaced by an outlet valve of a new make, ODE. The part number remains the same.

  The dispensing valve 1/8" - 2.0 mm, part number 41532005, will be replaced by an outlet valve of a new make, ODE in all ES5100 machines produced in approximately week 14-2006. The part number remains the same.

  In ES5100 machines from serial number 582529, the angle union, part number 062309 from the espresso boiler to hose for brewer water inlet has been changed into a standard type. The part number remains the same.

  The hexagon nut, part number 09102710 is omitted.

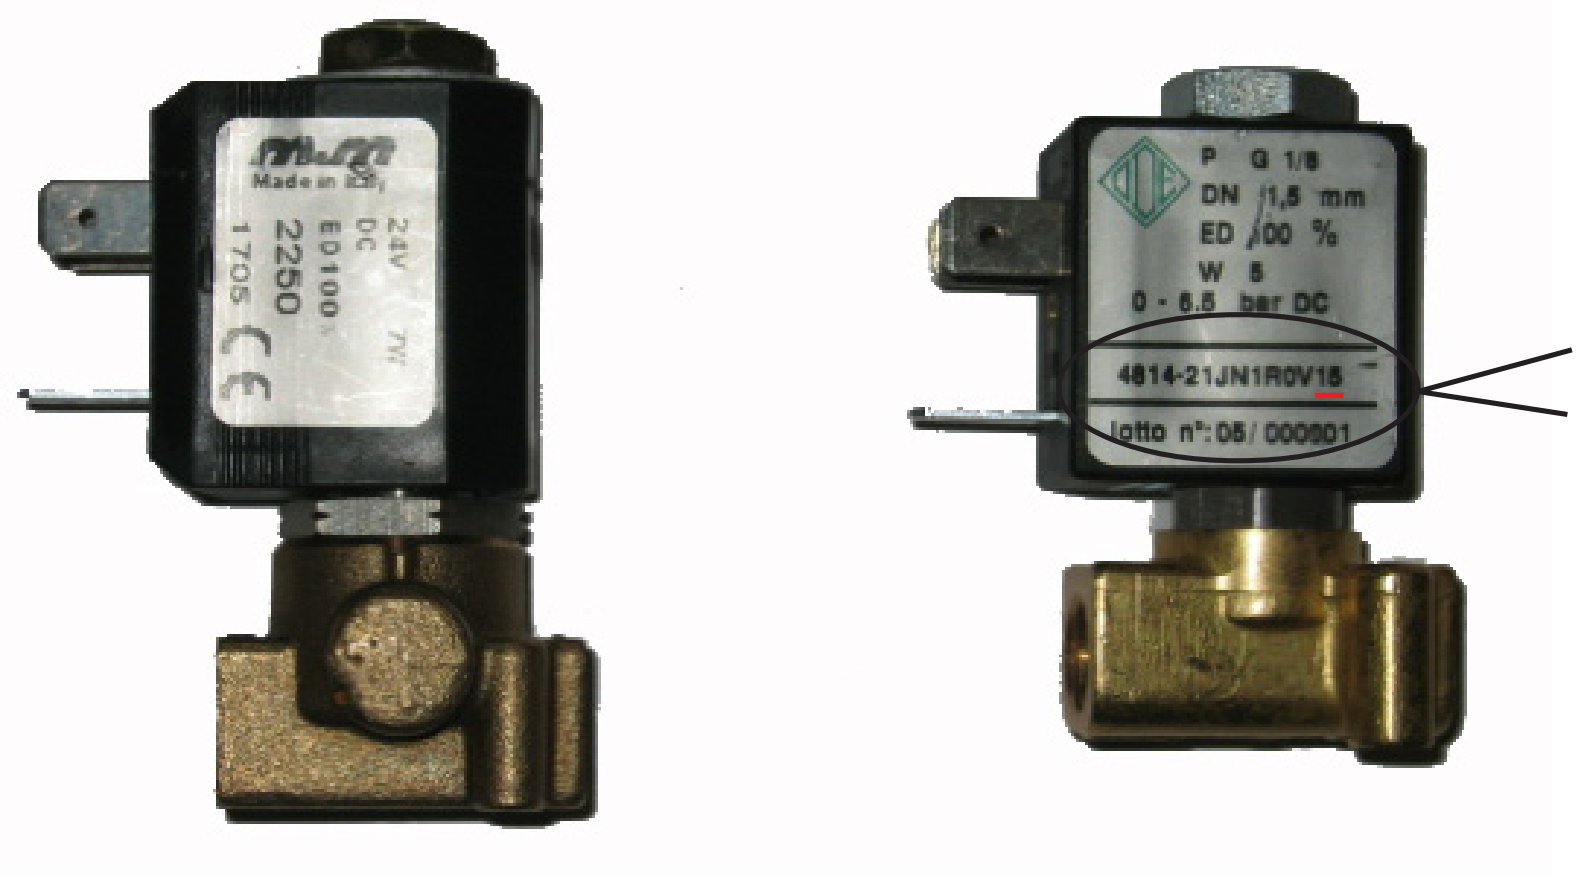

CODE
21JN1R0V15 - part no 41532003
21JN1R0V20 - part no 41532005

OLD MAKE
MM

NEW MAKE
ODE

REASON

- Product review.

REPLACEABILITY

- The changed outlet valves, part numbers 41532003 and 41532005 replace the previous ones directly. As the threading design of the water inlet on the changed valves has changed into a conical shaped at the bottom, the hexagon nut part number 09102710 is no longer needed as a spacer, and is thus omitted.

- The changed angle union, part number 062309, which has been replaced by a standard part by the supplier, replaces the previous angle union directly.